

Technical Service Bulletin

SUBJECT:
Liftgate Flipper Glass
Water Leak

NO: 23-61-98

GROUP: Body

DATE: Dec. 18, 1998

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, without written permission of DaimlerChrysler Corporation.

THIS REPAIR IS COMPATIBLE WITH DAIMLERCHRYSLER'S MOBILE SERVICE PROGRAM AND DOES NOT REQUIRE HOISTS OR OTHER FULL SERVICE FACILITY SPECIAL EQUIPMENT.

MODELS:

1999 (WJ) Grand Cherokee

SYMPTOM/CONDITION:

Some vehicles may exhibit a water leak at the rear liftgate flipper window. This leak will generally only occur during a car wash utilizing high pressure spray. An improved seal has been developed which will address this condition.

DIAGNOSIS:

If a vehicle exhibits this condition, perform the Repair Procedure.

PARTS REQUIRED:

1 55136053AC Seal, Flipper Glass

REPAIR PROCEDURE:

This bulletin involves replacing the liftgate flipper glass seal.

1. Open the liftgate flipper glass.

NOTE: THE FLIPPER GLASS SEAL UTILIZES A SEALING COMPOUND WITHIN THE SEAL CHANNEL. USE CAUTION WHEN REMOVING THE SEAL. IT MAY BE NECESSARY TO PROTECT THE SURROUNDING TRIM WHEN REMOVING THE SEAL.

2. Clean any sealing compound from the seal flange with MOPAR Superkleen or an appropriate solvent.

3. Install the new seal, P/N 55136053AC, in the opening making sure that the paint dots on the new seal are aligned with the upper corners of the opening.

POLICY: Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No: 23-51-28-90 0.2 Hrs.

FAILURE CODE: P8 - New Part